

User manual MSR 145

Contents

O-fata in atmosticus and occurring	_
Safety instructions and warnings	
Operating Instructions MSR 145 Modular Signal Recorder	
Overview	
Controls	
Turning the unit on / saving measurement parameters	
User checks	
Cleaning	
Charging the battery	
Specifications	
Operating, transport and storage conditions	
Troubleshooting	
Packing list	
Warranty	
Disposal	
•	
MSR PC software	
Setup Basic settings	
Prediction.	
Shock Assistant	_
Reducing the volume of data	
Conditional recording of measurement parameters (limits)	26
LED behaviour	
Transferring basic settings to several MSR145s	
User settings	
Calibrating the acceleration sensors	
Calibrating the descentiation sensors	31
Formatting the memory	32
Reader	33
Viewer.	
Online	40
MSR Utility programs	42
CSV	43
Cutter	
Calc	_
Concat	48
Additional software for PCs	
FreeMat	52
Address	53
	55

Important notes regarding this user manual

Important notes regarding this user manual

In this manual notes of particular importance are presented as follows:



Indicates that equipment may suffer damage or that there is a risk of injury to the operator or user should the instructions not be followed correctly.



Indicates that equipment may suffer damage or that data loss may occur should the instructions not be followed correctly.

Conventions

Term / Symbol	Description	Example
MSR 145	In this manual the term "MSR145" is used to mean both "MSR145S", "MSR145WS" and "MSR145W"	
Commands, programs, menu items, functions, field names	Record	
-> X	See page X	-> 5
P	•Reference to further information •Further information	

Safety instructions and warnings



- Read the operating instructions carefully before using the MSR 145 or the MSR software. This will protect you personally and avoid damage to the unit.
- The MSR 145 is a unit for recording and displaying measurement parameters and may not be used for safety-related applications.
- Before using the MSR 145 check the unit itself and all cables for visible signs
 of damage and never operate a damaged MSR 145. A damaged MSR 145
 can endanger operator safety! Should the MSR 145 not function perfectly or
 appear to be damaged, send it to MSR Electronics GmbH for repair.
- Ensure that no fluids enter the MSR145's casing. Fluids cause corrosion damage and short-circuits inside the MSR145.
- The MSR 145 must never be opened or modified. The manufacturer cannot be held liable for damage resulting from use other than that for which the unit is intended, or from improper operation of the unit.
- Never use an MSR145 with a leaking battery. Should a battery leak be detected ensure that the electrolyte does not come into contact with the skin, the eyes or the mouth. Should this occur, thoroughly rinse the affected area with water for at least 15 minutes. Consult a doctor. Do not breathe in any vapours emitted. Immediately clean the electrolyte from the MSR145 using a soft cloth and dispose of the cloth subsequently.



CAUTION

 Ensure the proper disposal of an obsolete MSR145 and USB connection cable ->14.

Operating Instructions



MSR 145S



MSR 145WS



MSR 145W

Overview

The MSR 145 is a miniaturised universal datalogger for measuring and recording different physical measurement parameters. It contains a temperature sensor, a humidity sensor with integrated temperature, a pressure sensor and a 3-axis accelerometer (X, Y and Z axes). The measurement parameters can be transferred to a PC either once data logging is completed or during the data logging process.

The MSR PC program enables users to customise the way in which the MSR 145 measures and records data according to their requirements. The integrated clock (RTC) allows data from as many MSR 145 units as required to be synchronised and merged into a single data record.



MSR 145S



MSR 145WS




USB connection cable



CD with MSR software

Controls

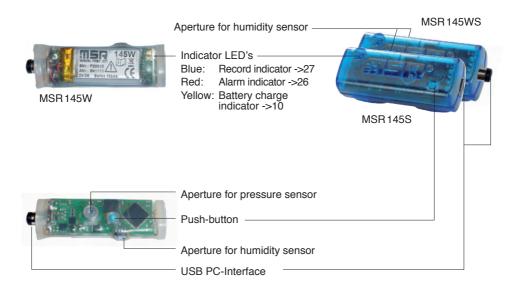

Turning the unit on / saving measurement parameters

The storage properties of the MSR 145 are determined using the **Setup** program*.

gram*.
Control of measurement parameter storage can be either time activated, value activated or by pushing the push button.

^{*}Setup is an MSR PC program (see Setup chapter ->23).

Maintenance

User checks

- Check the MSR 145 before each use.
- Before using the MSR 145 check for visible signs of damage.
- Check the functions of the MSR 145.
- Never use an MSR 145 that is damaged or not functioning perfectly. Never use damaged accessories.
- Ensure that the battery is sufficiently charged for the required period of use.

Should the MSR 145 not function perfectly or should damage become apparent send the unit to MSR Electronics GmbH for repair. Repairs may only be carried out by MSR Electronics GmbH or an authorised dealer. Defective or damaged components may only be replaced with manufacturer's original parts.

Cleaning



- MSR145S: Ensure that no fluids enter the MSR145's casing. Fluids will cause corrosion damage and short circuits.
- · Never use corrosive or abrasive cleaning agents or polishes.
- Cleaning agents containing additives such as alcohol will cause the case to become matt and/or brittle.
- Clean the MSR 145 when necessary.
- Always disconnect the MSR 145 from the PC before cleaning.
- Use a cleaning agent suitable for plastic or a cloth dampened with water and soap.

Charging the battery

Before first use:

The battery is not fully charged on delivery and should be charged for approx. 3 hours before using the MSR 145 for the first time.

Charge the MSR 145:

- Before each use
- At least every six months

Method:

• Connect the MSR 145 and the PC using the USB connection cable.

Notes:

- · Ensure that the PC remains switched on.
- The yellow LED illuminates during charging (continuously).
- · Charging is completed after a maximum of 3 hours.
- Recorded data is non-volatile and remains in the unit's memory even when the battery is exhausted.
- Never store the MSR 145 with a discharged battery.
 See ->13 (storage conditions).

Meaning of the yellow lamp when a USB device is connected

	Yellow LED	Meaning					
0	Lights continuously	Charging in progress					
0	Off	Fully charged or no connection to PC or PC turned off					
**	Flashes	Fully charged					
		The battery is recharged for a short time, e.g. during an online measurement or data recording					

Specifications

Measured parameters: • Temperature

Relative humidity with integrated Temperature
Pressure (e.g. altimeter, water level, barometer)
3-axis acceleration (e.g. determining position)

2 analog inputs (voltage range 0 to 3.0 V, 12 bit)

Working range:

Temperature: -10 °C to +58 °C

-55 °C to +125 °C (optional with external sensor)

Humidity: 0-100% relative Humidity, -20°C to +65°C

Pressure: 0-2500 mbar absolute

Optional: 0-14000 mbar absolute

Acceleration: $\pm 10 \text{ G} / \pm 2 \text{ G}$ selectable

Accuracy:

Temperature: ± 0.1 °C (5 °C to 45 °C)

±0,2°C (-10°C to +58°C)

Options with external sensor:

±0,1 °C (5 °C to 45 °C) ±0,5 °C (0 °C to +70 °C) ±2 °C (-55 °C to +125 °C)

Humidity: ±2% rel. humidity (10-85% rel. humidity, 0 to 40°C)

±4% rel. humidity (85-95% rel. humidity, 0°C to 40°C)

±0,5°C (0°C to 40°C)

Pressure: ±2,5 mbar (750-1100 mbar absolute)

Acceleration: $\pm 0,15g$ (25°C)

Storage rate: Temperatur and humidity: 1/s to every 12h
Pressure: 10/s to every 12h

Acceleration, Analog input: 50/s to every 12h

Memory capacity: Over 2000 000 measurement parameters

Push-button: Set bookmark or start and stop the record

General	eneral MSR145S MSR145WS		
Size (mm):	20x15x52	20x15x61	18 x 14 x 62
Weight approx.:	16g	23 g	18 g
Sheath material:	PC	PC	Silicon
Medium:	Air	Air, water	Air, water

Power supply:

• Rechargeable lithium polymer battery 170 mAh

• The battery is charged via the USB connection.

 One battery charge is sufficient for operation of the unit for several months

1100

Interface: USB


USB connection cable: Approx. 200 cm


Standards: The MSR145 complies with EU Directive RoHS /

(measurement rate 1/ minute)

WEEE.

MSR 145S: Protection Classification IP 60 MSR 145WS: Protection Classification IP 67 MSR 145W: Protection Classification IP 67

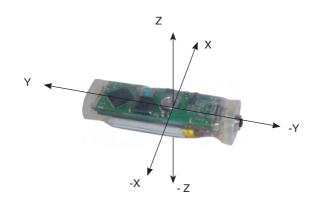

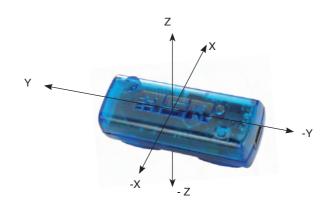

Operating, transport and storage conditions

- Protect the MSR145 from excessive exposure to the sun and other sources of heat. Avoid heavy impacts.
- Do not place heavy objects on top of the MSR 145.
- Only store the MSR 145 in a dry, dust-free environment.

Operating conditions:

Temperature: -20°C to +65°C

Pressure: 500 mbar to 2500 mbar absolute

Optimal storage and transportation conditions:

Temperature: 0°C to 45°C (ideal storage condition for the battery)

Humidity: 10-95% relative humidity, non-condensing

Battery charge level: Never store the MSR 145 with a discharged battery.

The ideal charge level is a 2/3 charge (a discharged battery achieves this charge level after approx.

2 hours' charging).

• MSR 145S: Avoid contact with water and humidity.

• MSR 145WS: Relative humidity: 30% to 95% max.

(storage and transport 10-95%)

• MSR 145W: Relative humidity: 30% to 95% max.

(storage and transport 10-95%)

Troubleshooting

Problem	m Possible cause Possible so					
The temperature increases continuously when the MSR 145 is connected to the PC	The battery warms up because charging commences when the MSR 145 is connected to the PC.	When making temperature measurements disconnect the MSR 145 from the PC.				
The MSR PC programs do not recognise the con- nected MSR 12	The COM port driver is not installed correctly.	Observe the manufacturer's installation instructions http://www.ftdichip.com/				

Packing list

- MSR145S, MSR145WS or MSR145W
- · CD including:
 - User manual
 - MSR PC software
- MSR145 USB connection cable
- · Warranty card

Options:

- · Additional sensors
- Adapter for connecting further sensors

Warranty

See warranty card.

Disposal



Take the MSR 145 to a municipal waste disposal centre or return it to MSR Electronics GmbH. The MSR 145 must not be disposed of in normal domestic waste.

Declaration of conformity





≣ISR®PC software

Setup	Setup
Reader	Reader
Viewer	Viewer
Online	Online

MSR®PC software

Overview

External processing of MSR145 data is carried out using the MSR PC software programs **Setup**, **Reader**, **Viewer** and **Online**. The MSR PC programs can be used for all MSR types.

The **Setup** enables the properties of the MSR 145 to be customised to user's requirements.

The **Reader** allows the user to transfer measurement parameters to a Windows PC. The **Viewer** is used to display data graphically or in table form or to export it as a text file (*.csv).


With the help of **Online** users can view measurement parameters and curves "live" on a PC.

Installation of the MSR PC software on a PC

For installation you will require Windows administrator rights.

Insert the CD containing the MSR PC software into the computer's CD-ROM drive. The installation procedure starts automatically*. During installation select: **Run MSR Modular Signal Recorder now**.

Completing installation

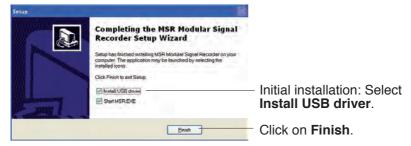

The MSR symbol # appears on screen.


If the PC is not set up for automatic installation, proceed as follows:

- Click Start > Run
- 2. Click **Find** > **Look in**: (set to CD drive).
- 3. Select the file **Install_MSR.exe** and **Open**.
- 4. In the Run dialog box click OK.
- 5. The installation process will begin.
- Follow the instructions and select: Run MSR Modular Signal Recorder now.
- During the initial installation select Install USB driver. See above, Completing installation.


^{*} The program "Inno Setup" for installing the MSR PC programs was written by Jordan Russell (www.jrsoftware.org, copyright Jordan Russell).

Starting the MSR Software

The MSR software may be started by clicking on the MSR symbol are or via **Start > Programs > MSR > MSR**.

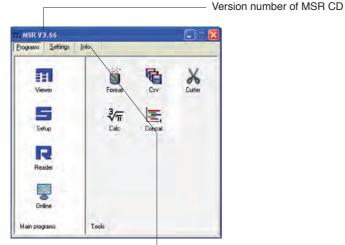

MSR program window

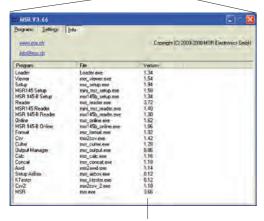

Version numbers of MSR PC programs

Uninstalling

The software is uninstalled via the computer's operating system (Programs > MSR > Uninstall MSR).


System Requirements

- Windows 95 or higherUSB port

Preparation


Before using the MSR PC programs **Setup**, **Reader** and **Online**, the following preparations must be completed:

- Use the USB connecting cable to connect the MSR 145 with the PC.
- Before first use: Using open the MSR program window, select Settings > MSR.
- Select the rule by which the **Setup, Reader** and **Online** programs are to search for the required MSR*.

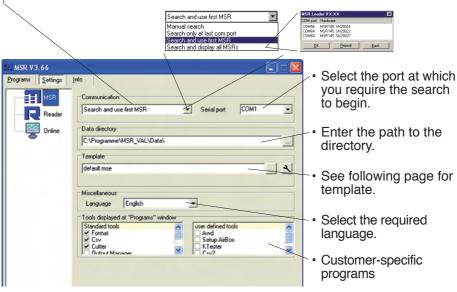


MSR program window

* One of the following windows will appear if a connection to an MSR cannot be established using the current rule.

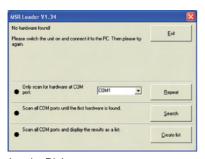

Loader Dialog

Im Setup:

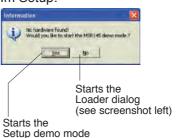

Template

The template, selected via **Setting** > **MSR** (*.mse), defines which sensors the **Reader** reads out as standard or are displayed in **Online**. The template sets the colour of the trace, the positioning of its axis (left, right) and gives the sensors a name ("HUM, T1" is required to be displayed as "outside temperature", for example). Templates can be produced on the basis of examples contained in **Viewer** (->34).

Example

The temperature curves are required to be blue and oriented on the right hand axis in all display modes.


- 1. Assign right hand axis and blue colour shades to temperature in **Viewer**.
- 2. Save as template (Bluetemp.mse).
- 3. Generate new templates for **Reader** and **Online**: Select MSR program window, **Settings MSR > Template** ■, enter new name and path (Temperature.mse), then **Open**.
- Open the still blank template (Temperature.mse) using
- Import the template that was created in Viewer (Bluetemp.mse).
 Select the required sensors (tick in checkbox) in the Module column and confirm with Accept.
- Edit the displayed list: First select a sensor in the Module column and then choose Edit.
- 7. Change the name "HUM, T1" to "Outside temperature", and **Accept**.
- 8. Continue to make the necessary adjustments and confirm them with **Accept**.

Pre-adjustments - Reader

Enter the required options for the **Reader**** via **Settings** > **Reader**.

Data records are transferred from the MSR 145 to a PC using the **Reader.

Once data transfer is complete the **Reader** creates a data record (*.msr) from each logged record, names it and saves it in the corresponding directory. The bottom-most option allows the user to alter the suggested filename and location.

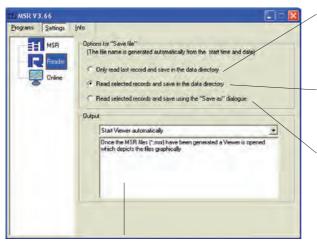

Transfer only the most recent data record logged with the MSR 145 to the PC.

User defines which records are transferred to the PC.


User defines which records are transferred to the PC, their filenames and their location.

Once the data has been transferred to the PC various options are available to the user. Details may be found in the text window.

Example: "Automatically generate a text file" In addition to the MSR format file, the **Reader** creates a text file (*.csv), which can be opened with programs such as e.g. Microsoft Word or Excel.

Pre-adjustments - Online

The functions described on this page are currently not available with the MSR 145.

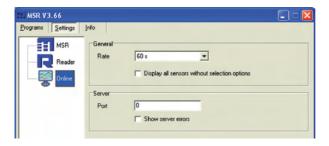

Completion of the preparatory measures

Upon exiting **Settings** the PC saves the settings that were last entered. The default settings can be reinstated by selecting Settings > MSR > Default.

Once entry of the settings is complete, select **Programs** and start the required program.

Note: The following instructions assume that the preparations for using the MSR PC programs have been completed.

Setup

Setup is used to select the sensors for which the MSR145 is required to save measurement parameters, to enter the measurement frequency and to set the behaviour of the MSR's memory. In **Setup** you can also define the start time for data recording and stop data recording.


The following subjects are dealt with in the **Setup** chapter:

Basic settings		٠	٠				٠	٠		٠	٠		٠		24
Shock Assistant							•	•	•			•			25
Reducing the volume of data															26
Conditional recording of measurement parameter															
Setting the alarm															
LED behaviour	•	•	•	•	•	٠	٠	•	•	•	•	•	•	•	27
Transferring basis settings to several mort 1400.	•	•	•	•	•	•	•	•	•	•	•	•	•	•	_,
Enter the name of the MSR 145															
Setting the measure range of the accelerometers															
Setting up the analogue inputs															
Calibrating the acceleration sensors Calibrating the humidity and temperature sensors															
campitating the harmany and temperature concern		•	•	•	•	•	•	•	•	•	•	•	•	•	51
Formatting the memory															32

Basic settings

Note: This page describes the most commonly used settings – the **Basic settings**. Information on further settings can be found on the following pages.


- Complete the preparations (->19).
- Start Setup (Setup symbol).
- Under Read basic settings, read the configuration saved in the MSR 145.
- Edit the Basic settings according to your requirements.
- Transfer the new configuration and the start conditions to the MSR 145 with Write basic settings.

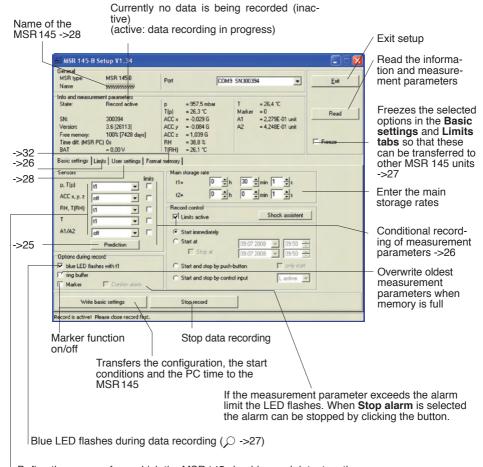

Define the sensors from which the MSR145 should record data, together with the storage rate Define the sensors from which the MSR145 should record data, together with the storage rate

t1 ~10 Hz (51/512 s) ~20 Hz (26/512 s) ~50 Hz (10/512 s)

Prediction

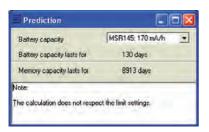

The maximum amount of data that can be recorded is influenced by:

- The number of sensors
- The measurement rate
- The battery capacity

With each click on **Prediction** (**Basic settings**) the program generates an approximate prediction using the selected basic settings.

Note: The Limit settings are not taken into account here.

Shock Assistant



Using the Shock assistant you can rapidly configure the MSR 145 for a shock measurement (conditional recording of accelerations).

Menu access via Basic settings > Shock assistant.

Only those acceleration values are recorded that exceed the value set for the threshold limit. Acceleration due to gravity over and above the measurement is not taken into account.

The figure input for the threshold value is set as the limit for the X, Y and Z axes of the accelerometer. The accelerometer and limits are activated, 50Hz is used as the measurement rate.

Note: Other settings are not affected.


Reducing the volume of data

When making extensive recordings it is recommended that all sensors that are not required be "turned off". This prevents unrequired measurement parameters from being saved.

- Under Basic settings turn "off" all unused sensor groups (see next section).
- To turn off individual sensors within one sensor group proceed as follows: Set the cut-in condition such that they are not activated during the planned recording (e.g. > 200 °C) (see next section).

Conditional recording of measurement parameters (limits)

If for example, you require only to record temperatures above 5°C and less than 20°C, use the following procedure

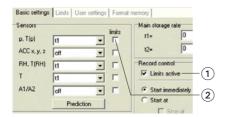

• Activate Limits active ① and the corresponding temperature sensor ②.

The **Limits** tab opens.



The MSR145 only records measurement parameters from the sensor T(p) above 5°C and less than 20°C

- In the columns Record Limit, Limit L1 and Limit L2 enter the cut-in conditions for the sensor.
 - Return to the Basic settings with and click Write basic settings. The limits will only be transferred to the MSR with Write basic settings.

Setting the alarm limit

The MSR 145 can display an alarm if a certain measurement parameter drops below or exceeds a certain value. When the alarm condition occurs the red LED flashes once per second until the data recording is stopped or the alarm function is exited (->24).



Inputting the alarm condition is carried out in the same way as setting the cut-in conditions (see section **Conditional recording of measurement parameters**). In the **Alarm Limit, Limit L1** and **Limit L2** columns enter the alarm conditions. The alarm limits can be displayed in **Viewer**.

The behaviour of the blue LED is defined via **Setup > Basic settings**.

		Options during record					
Situation		Behaviour of the blue LED					
Start time has been transferred	First 5 seconds	Double-flashes 5 times at 1-second intervals					
to the MSR 145 (nonfuzzy)	Warten auf Start (scharf)	Double-flashes at 5-second intervals					
Datenaufzeich- nung läuft	Flashes 5 times at 1-second into						
	After 5 sec- onds	LED flashes with main storage rate t1 LED does not flash					

Transferring basic settings to several MSR 145s

Use the following procedure to transfer basic settings that have already been input to several MSR145s:

- Start **Setup**.
- Connect the MSR 145 to the PC. (If several MSR 145s are connected to the PC, select the COM port of the required MSR 145).
- Enter the required values in the **Basic settings tab**.
- Set the cut-in and alarm conditions in the Limits tab.
- Use Write basic settings to transfer the basic settings to the MSR 145.
- Disconnect the MSR 145 just configured and connect the next MSR 145 to the PC.
- Select the new MSR 145 via COM Port.
- Caution! If you wish to import the information and measurement parameters of the newly connected MSR 145, you must first select the option Freeze ->24, so that the settings in the Basic settings and Limits tabs are not overwritten!
- Transfer the basic settings to the MSR 145 with Write basic settings.

Note: It is also possible to configure differently equipped MSR145s with a single basic setting. One MSR145 may for example, not be equipped with any analogue inputs. The setup program then simply does not write any data to the settings saved in the MSR145 for those analogue inputs.


 If a connected MSR deviates too greatly from the first MSR, this message appears:

User settings

To display the configuration saved in the MSR 145 select the Basic settings tab 1) and click Read basic settings. The settings are now displayed in the User settings tab.



The changes made in the User settings tab and its sub-menus will only be transferred to the MSR 145 after clicking Write user settings (2).

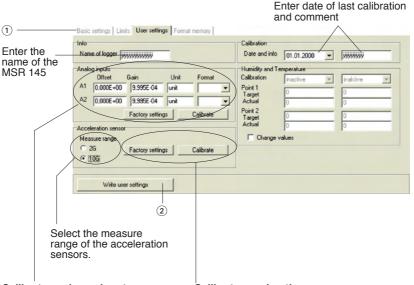

Calibrate analogue inputs Here you can enter the offset (zero

point) and gain, calculate them via **Calibrate** ->29 with the help of an assistant or you can reset them to the factory settings.

Calibrate acceleration sensors

Calibrate the acceleration sensors as required manually via Calibrate -> 30 or activate the

factory settings.


Note: The fields available for input are dependent upon the respective MSR 145.

Calibrating the analog inputs

The analogue digital converter (ADC) of the MSR 145 converts an external voltage U between $0.0\,V$ to $3.1\,V$ into an internal digital signal D between 0 and 4095. This signal D is converted to the value displayed A using the linear equation $A = m^*D + n$. Here m represents the gain and n the offset (zero point).

Two options are available for calibration:

- a) For the high and low point the required target values ① and the corresponding ADC values ② are entered manually. Then the offset (zero point) and the gain ④ are automatically calculated by clicking on Calculate ③.
- b) For the high and low point the required target values ① are entered manually. Then the voltages applied to the MSR 145 for the high and low points are measured by clicking on **Measure** ⑤. Clicking now on **Calculate** ③ allows the offset (zero point) and the gain ④ to be calculated.

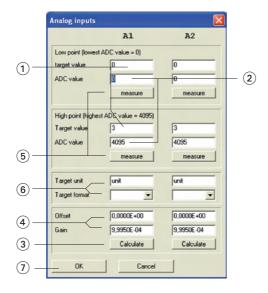


The appearance of the displayed value is set by entering the target unit and format (a) (number of decimal places).

- Complete calibration by clicking **OK** (7).
- Transfer the new calibration settings to the MSR 145 by clicking on Write user settings.

Calibrating the acceleration sensors

Depending upon requirements, the acceleration sensors may either be manually calibrated or the **Factory settings** may be activated from the **User settings** tab. Transfer the new calibration settings to the MSR 145 using **Write user settings**.

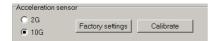

Resetting calibration to factory settings


- Select the **User settings** tab and click on **Factory settings**.
- Transfer the factory settings to the MSR 145 with Write user settings.

Manual calibration

 Select the User settings tab and click Calibrate.
 Click on Help to display the Position of the axes.



- Select the 2G measure range.
- Hold the MSR 145 so that the + X axis is oriented vertically bottom-to-top.
- Click on measure 1.
- Turn the MSR 145 over. Now the -X axis is oriented vertically bottom-totop.
- Click on measure 2.
- Repeat the procedure for the +Y, -Y, +Z and -Z axes.
- Select the **10 G measure range**.
- Hold the MSR 145 so that the + X axis is oriented vertically bottom-to-top.
- Click on measure 3.
- Repeat the procedure correspondingly for the +X, +Y, -Y, +Z and -Z axes.
- Complete calibration by clicking OK.
- Transfer the new calibration to the MSR 145 with **Write user settings**.

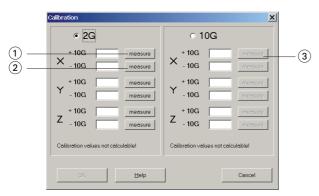

Calibrating the humidity and temperature sensors

For humidity and temperature the two point calibration procedure can be carried out.


Preparation

Before measurement of the actual values is carried out any existing two point calibration should be removed:

- 1. Check Change values 1
- 2. Deactivate the parameters to be calibrated ② (inactive)
- 3. Transfer these settings to the MSR 145 via Write user settings. Now the current measurement parameters may be used as actual values.

Carrying out calibration

- 1. Check Change values 1
- 2. Activate the parameters to be calibrated 2
- 3. Enter the target 3 and actual values 4 for both points.
- 4. Transfer these settings to the MSR 145 via Write user settings.

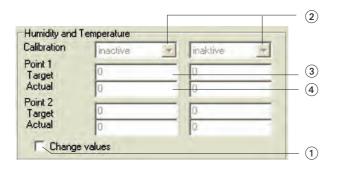


Formatting the memory



Formatting will erase all measurement parameters saved in the MSR145!

Formatting is used to delete all the measurement parameters saved in the MSR 145.

Formatting the MSR 145 is carried out from the Format memory tab.

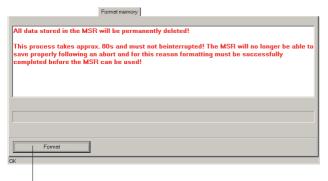

Deletes all measurement parameters saved in the MSR 145

Reader

With the **Reader** users can selectively transfer data records logged with the MSR 145 to a PC. It does however free measurement records that have already been read out for overwriting.

Transferring data records to a PC

- Complete the preparations (->19).
- Start the **Reader** (Reader symbol)




Once data transfer has started (**Start**) all data records saved on the MSR 145 can be overwritten if required, even if the circular buffer is deactivated in Setup.

Begin data transfer with Start.

The options selected under **Settings** > **Reader** (->21) influence the next steps:


 Under the option Read selected records the following data entry dialog box appears:

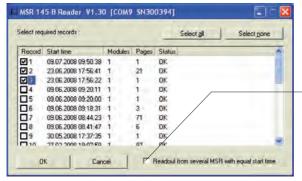

- Select the data records to be transferred.
- Click OK.
- Data records having the same start time are written together to one file.

With the option Read selected records and save with "Save dialog as" under Settings > Reader (->21) the filenames and locations suggested by Reader can be overwritten.


Once the data records have been saved on the PC a list of files created appears.

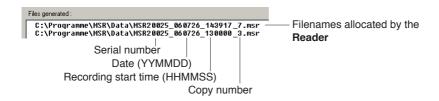


Viewer

Records created in **Reader** or **Online** may be viewed and edited on a PC with the **Viewer**. The measurement parameters may be displayed either in graph or in table form.

- · Start the Viewer (Viewer symbol).
- Open a record (*.msr) via File > Open.

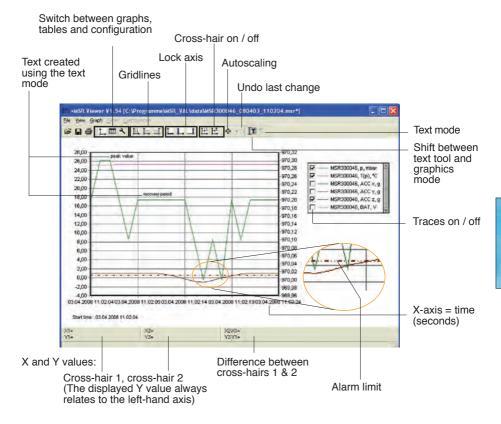

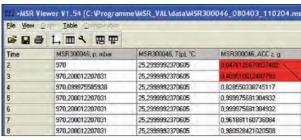

Displayed as a table

Alarm limit exceed


With right mouse button held down. Move traces

Mark the required section with the left mouse button held down. See also **Graphics** > **Fixed Enlarge section**

axis.

Cross-hair Move axis: Grab the axis, move with left mouse button.

Grab the centre, move with left mouse button. Move centre:

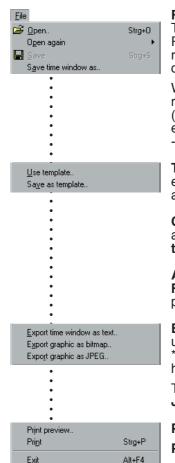

File

The **File** menu is used to **Open** records **≅**, to Reopen (**Open again**) the most recently used records and to **Save** the currently open record as displayed **■**.

With **Save time window as** the measurement parameters of the displayed time window are saved. (The measurement parameters of the hidden traces are also saved). For further options see **Cutter**->44.

Templates help to standardise the displays, enable easy repetition when reselecting the same sensors and the same printing format.

Creating templates: Adjust the display with Graph and Configuration ♣ and save via File > Save as template (file type: *.mse).

Apply a template to the displayed record: File > Use template then select the required template (*mse).

Export Time window as text exports the measurement parameters of the displayed time window in *.csv format. The measurement parameters of the hidden traces are also exported.

The trace can be exported in **Bitmap** (*. bmp) or as **JPEG** format.

Print preview opens a preview of the trace/graph. **Print ■** opens the print dialog box.


Exit closes the Viewer. If changes were made the user is asked whether the changes should be

saved.

The program saves changes as "Template" (*. mse). The template is automatically saved in the record's directory. Template (*. mse) and record (*. msr) have the same name.

Upon **Open**ing a record the **Viewer** searches for the template associated with that record. Should the template not be located in the same directory as the record then the standard format will be opened.



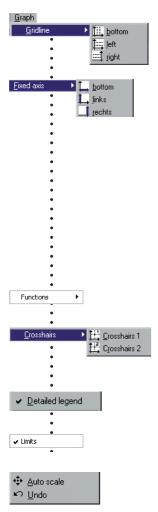

View

The **View** menu allows measurement parameters to be displayed as a **Graph** ⊥ or **Table** Ⅲ. Alternatively, using **Configuration** N the display method can be customised to the user's requirements.

Graph

Gridlines can be shown for each axis (bottom, left, right).

Fixed axis simplifies the amount of detail shown within a time window or range of values.

- Select the required section with the left mouse button held down. The section is displayed enlarged.
- For closer viewing, lock the time window (L) or range of values to the left or right axis (L/ ⊥1).
 Several axes can be locked.
- With the left mouse button held down, select the required detail. The enlargement is displayed without altering the time segment or range of values of the locked axes.

Calculation functions

Using the two **Crosshairs** values can be measured on the X and Y traces. X and Y differences can be evaluated with the second cross-hair. The Y values displayed are always associated with the left axis.

With **Detailed legend** traces can be turned on and off in the list of sensors.

If available: Display of the alarm limits (see ->34).

The complete record is displayed by selecting **Auto scale** .

Auto scale
clears all locked axes.

Undo ID undoes the last enlargement. As long as the **Configuration** dialog **ID** is not quitted, **Undo ID** allows the last changes made to the displayed configuration screen to be undone.







Delete

•

Insert X1, Y1 Insert X2, Y2 Insert X2-X1, Y2-Y1

Table (Tabelle)

Go to time allows users to jump straight to the line in the table with the required time.

Jump to beginning of graph \blacksquare causes the table to jump to the first measurement values displayed in the graph.

Configuration

As long as the **Configuration** \(\mathbb{N}\) dialog is not quitted, **Undo** \(\mathbb{D}\) allows the last changes made to the configuration screen to be undone.

Text mode

Using the text mode you can insert texts at any place.

By clicking on T you can activate and deactivate the text mode.

Insert text:


- Click on . The viewer displays "Text 1" in the upper left corner.
- Drag the text field to the desired place.
- Double click on the text field and enter your required text.

Delete text:

 Click with the right mouse button on the text field and select **Delete**.

Text field with X and Y values:

- place the crosshairs (->37) on your chosen position to adoddopt the X and Y values you would like to use in the text field.
- Create a text field (see above) and click on the right mouse button.
 Select the desired representation.

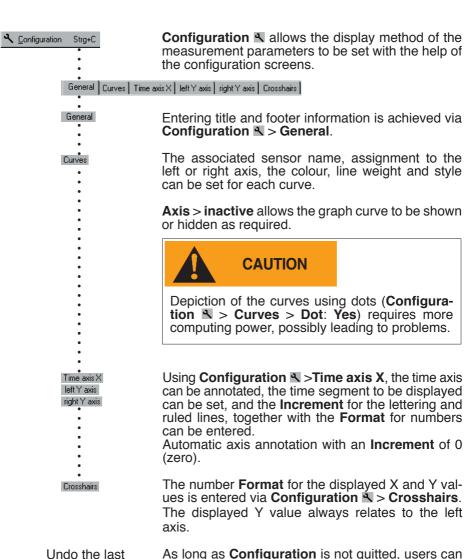

Undo the last changes

As long as **Configuration** is not quitted, users can undo the last changes made to the displayed configuration screen with .

Quit Configura-


Quit Configuration \(\) via Graph \(\) or Table \(\). Upon quitting, the Viewer saves the configuration.

Online

Online allows users to view the progress of the measurement parameters directly on-screen.


Procedure:

- Complete the preparations ->19.
- Start Online (Online symbol).

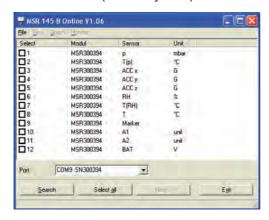

- · Select the sensors that you wish to display.
 • Click on **Next**.

· Online displays the measurement parameters graphically and numerically.

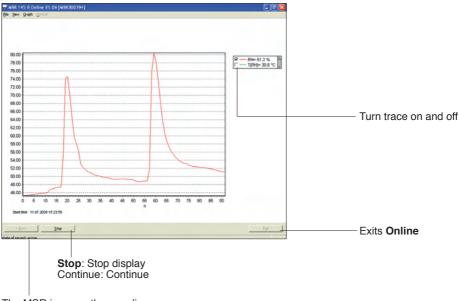

The MSR is currently recording measurement parameters



For recurring applications in **Online**, **Templates** assist in selecting the required sensors and adjusting the display to suit.

Create template: Start **Online** and select the required sensors. Select **Next>**. Use

Graph > Properties, Graph > Grid line, Graph > Legend and

Graph > Start time to change the way the curve is displayed. Via Back return to the trace display. Interrupt recording with Stop. Save the template via File > Save as template.

Apply the template to Online: File > Use template and select the required template (*mse).

Once recording has finished by clicking on **Stop**, the recorded measurement parameters can be saved via **File** > **Save** as



Save as...

In the menu **View** the measurement parameters can be displayed as curves with **Graph** or as numerical values with **Monitor**. The font displayed on the monitor can be selected via the menu **Monitor** > **Font**.



Once recording has finished by clicking on **Stop**, the recorded measurement parameters and traces can be deleted via **Clear**.

The display can be changed via **Properties**, **Gridlines**, **Legend** and **Start time**.

Select the frequency (**Refresh rate**) with which measurement parameters are to be transferred to the PC.

In the **Time window** you can define the time period represented by the time axis.

≣15R® Utility programs

CSV	
Cutter	
Calc	
Concat	

CSV

The **CSV** utility creates text files (*.csv or * .fmc) from data records (*.msr). Files saved in *.csv format can subsequently be opened and edited in a word processing or spreadsheet application. The *.fmc files can be transferred to FreeMat¹.

Creating a text file

• Start CSV (MSR Program window > Tools > Csv).




- Select the output format (standard *.csv or Free-Mat * .fmc)
- Click on Start and select the data record from which the text file is to be created. CSV creates a text file (*.csv) and saves it in the corresponding directory for that data record. Text file (*.csv) and data record (*.msr) have the same name.

Note on creating *.csv files: If a template (*.mse) exists for the data record in question, **CSV** takes this into account when creating the text file (*.csv).

Example: Opening a CSV text file with Excel

- Start the word-processing or spreadsheet program.
- Open the CSV file via File > Open.
- Under File type, select Text Files.

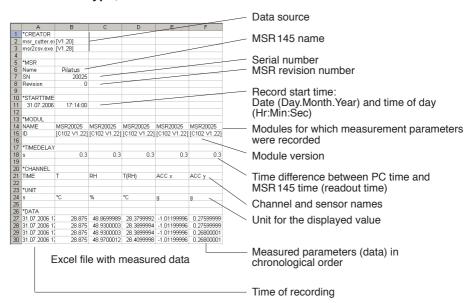


¹ Further details on FreeMat can be found in the section FreeMat ->52

Cutter

The **Cutter** utility creates an extract from a data record (*.msr).

Creating an extract from a data record

• Start the **Cutter** utility (**MSR Program window** > **Tool** > **Cutter**).

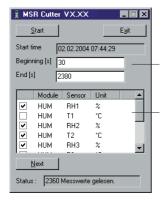

- Click on Start and select the data record from which the extract is to be created.
- Select the time window. Beginning / End.
- Select the sensors for which the measurement parameters are to be exported to a new data record and click Next.
- Enter the name and directory for the new data record. Click on Save.


Calc

With **Calc** curves from existing data records can be linked to each other using formulae and saved as a data record (*.msr). The saved data record can be displayed and processed in the form of curves or as a table using the **Viewer**. Templates simplify the processing of recurring tasks.

Note: For making comprehensive calculations the FreeMat math software is available (see ->52).

Computing new curves

Start Calc (MSR program window > Tools > Calc)

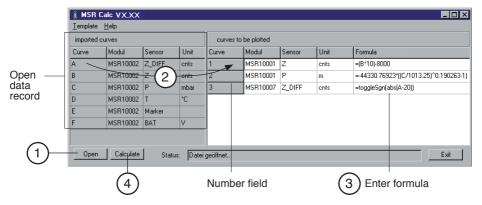

- 1 Open data record (data origin)
 Click on Open to open the data record for which you want to perform calculations on the curve. It is possible to open multiple data records.
- (2) Create new curves
 From imported curves select the curve that you want to use for your calculations and drag it with the left mouse button pressed to the right into the field for curves to be plotted. Repeat this procedure until the required number of curves is shown on the right.
- (3) Enter formula
 Enter the formula to be used for the new curve into the Formula column.
 For this, use the capital letters on the left.
 Example for a subtraction: A-C

You will find a list of the available functions at the end of this section or under **Help**.

Modify the text for the new curves

The entries in the columns Module, Sensor and Unit can be modified.

Modify the order of the new curves

With the left mouse button pressed, drag the number field to the required position.

Delete new curves

<u>T</u>emplate

Delete plotted curve

Click inside the number field of the curve to be deleted and then press the delete key. Via **Template** > **Delete plotted curve**, all new curves can be simultaneously deleted.



Calculating and saving the new curves

Click on **Calculate** then enter the name and set the directory for the new data record. Click on **Save**.

Note:

The curves are saved as data records (*.mrs). The saved measurement parameters can be displayed and processed as a curve or as a table by the Viewer. Intermediate values are interpolated.

Only curves that overlap timewise can be calculated.

<u>I</u>emplate

•

<u>W</u>rite

•

<u>R</u>ead

Creating a template for processing recurring tasks

Once you have created the new curves you can save their labels and formulae as a template (*.mse). (**Template** > **Write**).

Creating new curves using templates

Open the required template (*mse) via **Template > Read**. This will automatically generate a number of new curves. Multiple templates may be used to generate new curves. Each template generates a number of new curves.

Operators / brackets

+ - * / ^ Plus, minus, multiply, divide, to the power of

() Open brackets, close brackets

Functions

sqrt(no.) Square root of the number

In(no.) Natural logarithm of the number (base e) exp(no.) Raise basis e to the power of the number

abs(no.) Absolute value of the number

sgn(no.) no. >0: sgn=1

no. =0: sgn=0 no. <0: sgn=-1

cos(no.) Cosine of the number sin(no.) Sine of the number tan(no.) Tangent of the number ctg(no.) Cotangent of the number

arcsin(no.)

Arc sine of the number

arccos(no.)

Arc cosine of the number

arctan(no.)

Arc tangent of the number

arcctan(no.)

Arc cotangent of the number

sinh(no.) Hyperbolic sine of the number cosh(no.) Hyperbolic cosine of the number tangh(no.) Hyperbolic tangent of the number ctgh(no.) Hyperbolic cotangent of the number


toggleSgn(no.) Changes every second measurement parameter

sign (plus/minus)

Further functions on request

Concat


With **Concat** (concatenate = to link) data records can be linked together and saved as a new data record (*.msr). The newly created data record can be displayed and processed in the form of curves or as a table using the **Viewer**.

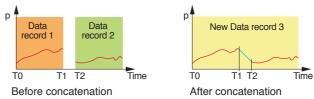

Concatenating several data records

Start Concat (MSR program window > Tools > Concat)

List of data records to be concatenated

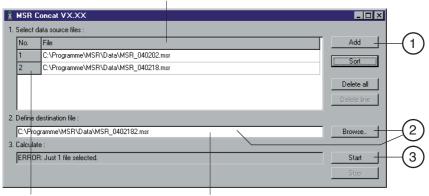

Number window

Status window

(1) Select the data records to be concatenated

Open the data records that you want to concatenate by clicking **Add**. Note that the list must be in chronological order such that the oldest data record is at the top. Therefore either open the oldest data record first or sort the list afterwards (see below).

Sort the list alphabetically

Use **Sort** to sort the list alphabetically.

Data records that have automatically generated filenames (->33) can be chronologically sorted using **Sort**.

Modify the data record order

With the left mouse button pressed, drag the number field to the required position.

Delete all data records from the list

Use **Delete all** to remove all data records from the list.

Delete one data record from the list

Select the data record to be deleted and click Delete line.

2 Enter the name and directory for the new data record
Set the path to the directory using **Browse** and enter the filename, or use the input window to do this.

3) Calculating the new data record

Start the calculation process with **Start**. Cancel the calculation with **Stop**.

Note:

- Concat creates a straight line between the last data record of the first curve (T1) and the first data record of the second curve (T2).
- New data record 3

 To T1 T2 Time
 Straight line created by Concat
- If, for the data records to be concatenated, there are curves that overlap timewise and these have the same name (same module and sensor names with the same units), the calculation will be aborted and a corresponding message* will appear in the status window.
- p1 1 p1
 Overlapping Time

- If the module names, sensor names or units of the curves to be concatenated do not correspond Concat will be unable to join the curves and will create two curves.**
- Sensor p1 Sensor p2


 Different sensor names

 New data record

 Time
- With Concat you can superimpose curves with different module or sensor names.
- Different sensor Time names and start times

* Remove overlap

Use the **Cut** utility to create an excerpt from a p data record that does not overlap timewise with the next data record.

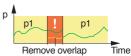

** Modify module names, sensor names and units

Use the Calc utility to match the module names, sensor names and units for the curves.

Output Manager

Output Manager

The Output Manager is currently not available.



Additional software for PCs

FreeMat	


FreeMat

FreeMat is open source math software that can be installed from the MSR CD (ADDITIONAL\FREEMAT). FreeMat can be used to carry out a wide variety of calculations.

How are data records transferred to FreeMat?

The Reader transfers the data recorded with the MSR 145 (records) to the PC. From these data records (*.msr) CSV creates FreeMat files (*.fmc). Using the scripts included these can be opened and edited in FreeMat.

More information on FreeMat can be found at http://freemat.sourceforge.net/index.html.

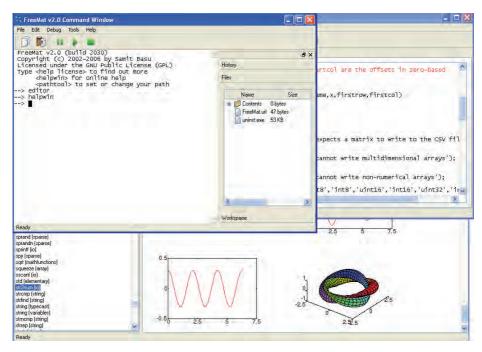

The following FreeMat scripts can be found on the MSRCD under ADDITIONAL\FREEMAT\MSCRIPTS:

plotmsr.m Imports *.fmc files into the FreeMat environment and

presents the data records graphically.

loadmsr.m Imports *.fmc files into the FreeMat environment.

MSR Electronics GmbH

Oberwilerstrasse 16 CH-8444 Henggart Switzerland Tel. +41 52 316 25 55 Fax +41 52 316 35 21 info@msr.ch www.msr.ch

(€